

## OCS-300 Operating Instruction - Calibration

Option	Display	Operations	Notes
Enter Calibration Mode		Press [HOLD] and [TARE] simultaneously, and keep pressing for 1 second.	Enter Setup Mode
	SETUP	Press [ON/OFF], [HOLD] and [TARE] simultaneously, and keep pressing for 1 second.	Enter Calibration Mode
	SCALE	Press [TARE].	
Full Scale	_XXXX	Press [HOLD] to change Full Scale, and press [TARE] to go to Resolution option.	Calibration unit is kg.
Resolution	E X	Press [HOLD] to change Resolution, and press [TARE] to go to Decimal Point option.	1/2/5
Decimal Point	Pt X	Press [HOLD] to change Decimal Point, and press [TARE] to go to Zero Calibration.	0: XXXXX 1: XXXX.X 2: XXX.XX 3: XX.XXX
Zero Calibration	LoAd0	Press [TARE] to go to Load1 Calibration.	Keep scale with no load and stable.
	-----		
Load1 Calibration	_XXXX	Press [HOLD] to change Load1 Calibration Weight, and press [TARE] to go to Load2 Calibration.	If FULL, calibration will be finished automatically.
	-----		
Load2 Calibration	_FULL	Press [TARE] to exit Calibration.	If Load2 calibration is not needed, press [OFF] to exit Calibration manually.
	-----		
	_End_		