

iDimension® Plus

Static Dimensioning System – Version 4.13

Setup and Operation Manual



An ISO 9001 registered company
© Rice Lake Weighing Systems. All rights reserved.

Rice Lake Weighing Systems® is a registered trademark of
Rice Lake Weighing Systems.

All other brand or product names within this publication are trademarks or
registered trademarks of their respective companies.

All information contained within this publication is, to the best of our knowledge, complete and
accurate at the time of publication. Rice Lake Weighing Systems reserves the right to make
changes to the technology, features, specifications and design of the equipment without notice.

The most current version of this publication, software, firmware and all other product
updates can be found on our website:

www.ricelake.com

Contents

1.0 Introduction	1
1.1 Regulatory Information	1
1.2 FCC Compliance	1
1.3 OIML/EU Certification Special Notice of Use	1
1.4 Safety	2
1.5 Installation Requirements	3
1.5.1 Measuring Platform	3
1.5.2 Scale Placement	3
2.0 Setup Wizard	4
2.1 Access Setup Wizard	4
2.1.1 Time Zone	5
2.1.2 Date and Time	5
2.1.3 Zero Height	6
2.1.4 Scan Zone	8
2.1.5 Certified Settings	8
2.2 Next Steps	10
3.0 Touchscreen Display	11
3.1 Touch Screen Display Operation	11
3.1.1 Live Image	11
3.1.2 Out of Bounds Indication	11
3.1.3 Shape Indication	12
3.1.4 Status Indication	12
3.1.5 Help Key	12
3.1.6 Zero Height Key	13
4.0 Configuration Menu	16
4.1 Access Configuration Menu	16
4.1.1 Setup Wizard	17
4.1.2 View EULA	17
4.1.3 Data Extract	18
4.1.4 Restart	19
4.1.5 Enable Flats	19
4.1.6 Upgrade Firmware	20
4.1.7 IP Address	21
4.2 Device Information	21
4.2.1 Device Information Key	21
4.2.2 Weights and Measures	22
5.0 Use and Operation	23
5.1 Measurement Capabilities	23
5.1.1 Flats	24
5.1.2 Object Types	24
5.2 Performing A Measurement	25
5.2.1 Automatic Package Detection	25
6.0 Network Connection	27
6.1 Connection	27



Technical training seminars are available through Rice Lake Weighing Systems. Course descriptions and dates can be viewed at www.ricelake.com/training or obtained by calling 715-234-9171 and asking for the training department.

6.2	DHCP Connection	27
6.3	Static IP Connection	28
6.4	Admin Tools Menu	28
6.4.1	Edit/Cancel/Save Keys.....	29
7.0	Setup.....	30
7.1	Setup Menu.....	30
7.2	General Settings	31
7.2.1	General Settings Parameters.....	32
7.2.2	Scale	33
7.3	Network.....	34
7.3.1	Network Security	35
8.0	Appendix	36
8.1	Diagnostics	36
8.1.1	Diagnostics Menu.....	36
8.1.2	Component Tests.....	37
8.1.3	Scale Test	38
8.1.4	System Log	39
8.1.5	Debug Info	39
8.2	Troubleshooting	40
8.2.1	iDimension Plus Does Not Return to Ready State.....	40
8.2.2	iDimension Plus Display is Off or Blank.....	41
8.2.3	iDimension Plus Display is Green	41
8.2.4	iDimension Plus Display is Locked and Will Not Dimension	41
9.0	Specifications	43



Rice Lake continually offers web-based video training on a growing selection of product-related topics at no cost. Visit www.ricelake.com/webinars

1.0 Introduction

This manual provides an overview of the iDimension Plus setup and operation instructions.

Ensure the iDimension Plus unit is fully assembled by following the instructions of the iDimension Plus Assembly Instructions (PN 197164).

When interfacing this device to third parties software, please reference the software manufacturer's documentation for setup and configuration parameters as necessary.



Manuals and additional resources are available from the Rice Lake Weighing Systems website at www.ricelake.com

Warranty information can be found on the website at www.ricelake.com/warranties

Additional Manual Resources

- iDimension Plus Assembly Instructions (PN 197164). The iDimension Plus Assembly Instructions describes how to assemble the iDimension Plus.
- iDimension Plus QubeVu Managers Guide (PN 195441). The iDimension Plus QubeVu Managers Guide is a detailed overview of the QubeVu Manager, the embedded firmware of the iDimension Plus.

1.1 Regulatory Information

This product is a Class 1 Laser Product according to IEC 60825-1:2007 Ed. 2.0 and complies with 21 CFR 1040.1 pursuant to Laser Notice No. 50. A laser source with a diffraction optical element is embedded in the product, which produces a maximum output power of 1.1 mW at the aperture with a maximum wavelength of 825 nm.

1.2 FCC Compliance

United States

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

Canada

This digital apparatus does not exceed the Class A limits for radio noise emissions from digital apparatus set out in the Radio Interference Regulations of the Canadian Department of Communications.

Le présent appareil numérique n'émet pas de bruits radioélectriques dépassant les limites applicables aux appareils numériques de la Class A prescrites dans le Règlement sur le brouillage radioélectrique édicté par le ministère des Communications du Canada.

1.3 OIML/EU Certification Special Notice of Use

The dimensions and/or volume shown are those of the smallest rectangular box that fully encloses the object.

1.4 Safety

Safety Signal Definitions:



Indicates an imminently hazardous situation that, if not avoided, will result in death or serious injury. Includes hazards that are exposed when guards are removed.



Indicates a potentially hazardous situation that, if not avoided, could result in serious injury or death. Includes hazards that are exposed when guards are removed.



Indicates a potentially hazardous situation that, if not avoided, could result in minor or moderate injury.



Indicates information about procedures that, if not observed, could result in damage to equipment or corruption to and loss of data.

General Safety



Do not operate or work on this equipment unless this manual has been read and all instructions are understood. Failure to follow the instructions or heed the warnings could result in injury or death. Contact any Rice Lake Weighing Systems dealer for replacement manuals.



Failure to heed could result in serious injury or death.

Electric shock hazard!

There are no user serviceable parts. Refer to qualified service personnel for service.

The unit has no power switch, to completely remove power from the unit, disconnect the power source at the AC outlet.

For pluggable equipment the socket outlet must be installed near the equipment and must be easily accessible.

When cycling power, use the in-line power cord at a power outlet, do not power at the base.

Always disconnect from main power before performing work on the device.

Do not allow minors (children) or inexperienced persons to operate this unit.

Do not operate without all shields and guards in place.

Do not place fingers into slots or possible pinch points.

Do not use this product if any of the components are cracked.

Do not make alterations or modifications to the unit.

Do not remove or obscure warning labels.

Do not use near water, avoid contact with excessive moisture.

Keep the unit dry.

Retain packaging. When transporting the unit, always disassemble and pack it in its original packaging.

Use only supplied power adapter. Never short-circuit the power adapter or the device.

Never remove the iDimension Plus head cover or the electrical connection panels at the base of the pole assembly.

Never modify or attempt to repair the unit. Service must be performed by Rice Lake Weighing Systems only.

Handle cables and cable connectors with care.

Never use damaged power cords, plugs or loose electrical sockets.

Never touch the power cord with wet hands.

Ensure that the base plate, pole assembly and head unit are all securely attached before attempting to move the unit.

Never lift the unit by grasping only the pole assembly.

Always ensure that both sections of the pole assembly and the base plate are supported.

Never drop or allow an impact to the head.

Mount on a flat surface.

Never use product for anything other than its intended purpose.

1.5 Installation Requirements

IMPORTANT

Avoid installation of the unit near direct sunlight or near bright lights. Direct sunlight and overhead lighting causes void pixels and noise that will affect the system from performing a dimension.

Protect the iDimension Plus from static electricity and connect to a clean AC power outlet.

Install the iDimension Plus on a table or sturdy level work surface large enough for the base plate and scale. Ensure the location provides a large enough work surface clear from other objects in the measurement area.

1.5.1 Measuring Platform

The iDimension Plus can be installed over any platform or surface. Measuring flat items, such as envelopes and small poly bags, requires a flat, non-reflective platform. Please contact Rice Lake Weighing Systems for further information.

1.5.2 Scale Placement

If using a scale, place the scale on the base plate, centered on the marks (Figure 1-1). Secure the scale into position. Continuous movement of the scale may provide inaccurate measurements. If the scale moves from the original position placed after a zero height or reset function, results may be inaccurate.

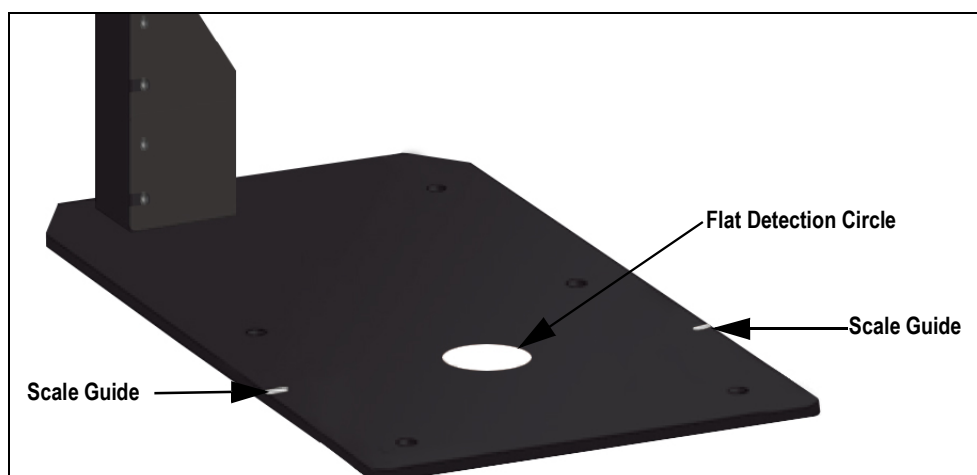


Figure 1-1. Scale Placement

2.0 Setup Wizard

This section provides an overview of how to setup the iDimension Plus.



The **Setup Wizard** displays during the initial power-up. Skip to [Step 3](#) if **Setup Wizard** displays.



Figure 2-1. Setup Wizard Prompt

2.1 Access Setup Wizard

If **Setup Wizard** does not display, see the following procedure:

1. From the display ([Figure 3-1 on page 11](#)), select the **Device Information** button  ([Figure 4.1 on page 16](#)) at the bottom of the display.
2. Select the **Configuration Menu** button  ([Section 4.1 on page 16](#)). **Configuration Menu** displays ([Figure 3-7 on page 15](#)).

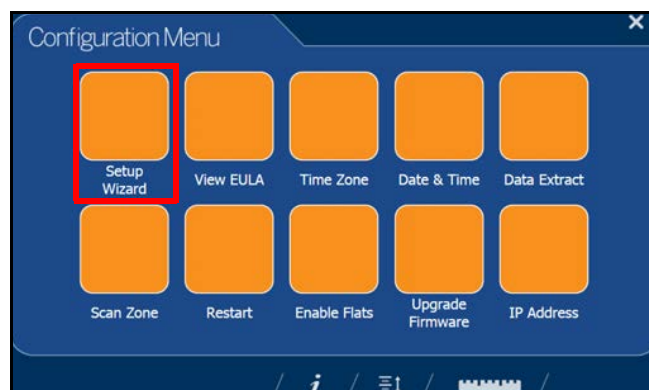


Figure 2-2. Configuration Menu

3. Select **Setup Wizard**.

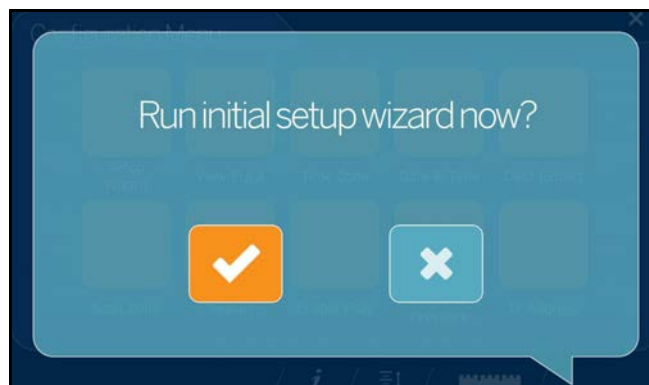


Figure 2-3. Initial Setup Wizard




2.1.1 Time Zone

The **Time Zone** button displays the current time zone.



Figure 2-4. Time Zone

Use the following instructions to edit the time zone.

1. Select **Time Zone**, the current time zone displays.
2. Select by selecting  or  to highlight the desired time zone.
3. Select  to continue.

2.1.2 Date and Time

The **Date and Time** button allows the adjustment of date or time if necessary.

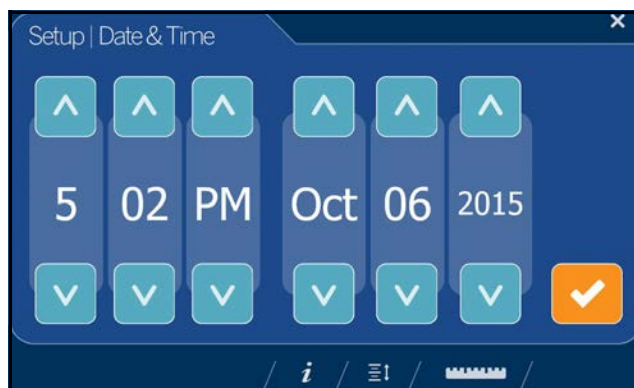





Figure 2-5. Date and Time

Use the following instructions to adjust the date or time.




1. Select **Time & Date**.
2. Select  or  to enter the current time and date.
3. Select  to continue.

2.1.3 Zero Height

1. Select the base type of the iDimension Plus.



Figure 2-6. Zero Height Base Selection Display (NEED IMAGE OF SCALE)

- If the base is a smooth top scale or no scale, only using the iDimension Plus base, select the  and proceed to [Step 3](#)
 - If the base has an uneven surface (roller balls or conveyor), not using the iDimension Plus base, select the  then continue to [Step 2](#)
2. Place the calibration object on top of the scale then select .

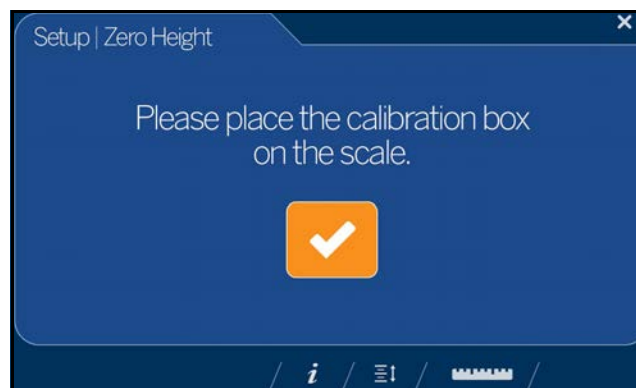



Figure 2-7. Place Calibration Box Display

3. Ensure the platform is clear of other objects then select .

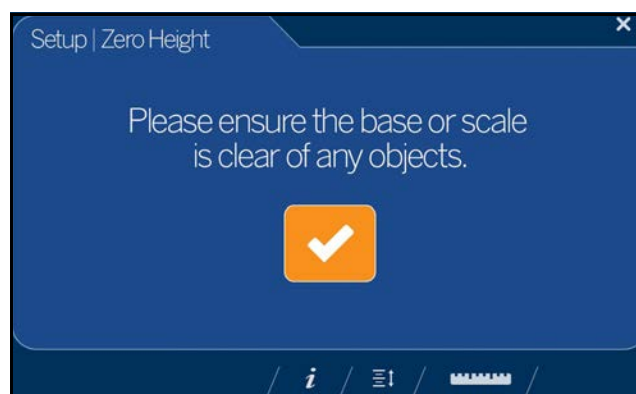


Figure 2-8. Ensure Base is Clear Display



Note

It is important to keep the scale or iDimension Plus base clear and unobstructed during the zero height calibration to set the zero height accurately.

- Stand clear of the unit before the countdown completes.



Figure 2-9. Stand Clear Display

- The operator is advised on amount the platform distance will be adjusted by and asked to confirm by tapping .

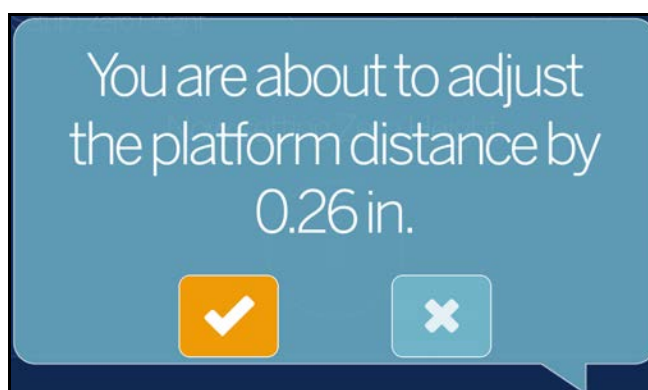



Figure 2-10. Confirm Distance

- Upon successful zero height calibration then select  (Figure 3-1 on page 11).
- Remove the calibration object, if used when the base has an uneven surface (roller balls or conveyor). The base is selected within [Step 1 on page 6](#).



Note

If the zero height fails, ensure the dimensioning area is clear, the scale is level and repeat the zero height function. If unable to perform a successful zero height, calibration may be required ([Section 2.0 on page 4](#)).

2.1.4 Scan Zone


The scan zone is the area the system uses to dimension an item. When configuring consider the area that needs to be clear from all other objects and is used to identify motion detected by an operator placing an item on the platform. Before the unit will attempt to perform a dimension, the scan area is required to be free from motion by the operator or objects near the device.

If the application has enabled flats, items than are less than 1.2" (3 cm) in height, the scan zone is required to be as large in length and width as the object.

1. Adjust the scan area by adjusting each of the four dots (touch points) on screen.



Figure 2-11. Scan Zone

2. Select  when scan zone is configured.

2.1.5 Certified Settings

1. Select  or  to select appropriate configuration profile.



Note

The default configuration is US (48"). Selecting --Current Settings-- leaves this unchanged.

Please contact Rice Lake Weighing Systems Support for advice on profile selection.

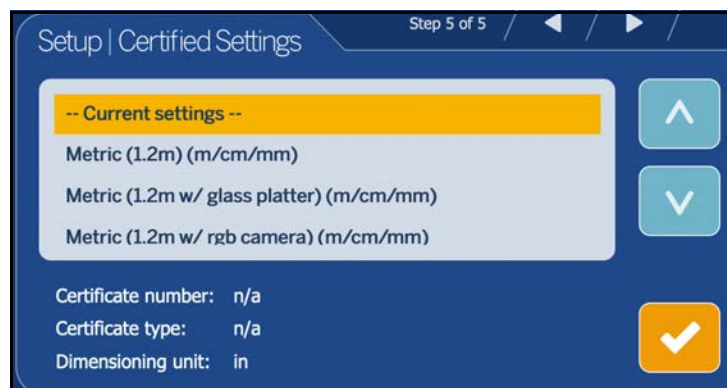


Figure 2-12. Certification Settings

The profile will depend on the hardware configuration and legal for trade requirements and was selected during the initial setup wizard. See [Table 2-1 on page 9](#) for detailed information on each profile.

Profile Name	Use If	
Metric (1.2 m)	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= Metric = 1.2 m > 3 cm No
Metric (1.2 m with glass platter)	Measurement unit Scan head mount height Scale with glass platter Legal for Trade application	= Metric = 1.2 m Yes No
Metric (1.2 m with rgb camera)	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= Metric = 1.2 m < 3 cm No
Metric (1.5 m)	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= Metric = 1.5 m > 3 cm No
Metric (1.5 m with glass platter)	Measurement unit Scan head mount height Scale with glass platter Legal for Trade application	= Metric = 1.5 m Yes No
Metric (1.5 m with rgb camera)	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= Metric = 1.5 m < 3 cm No
Metric (2.0 m)	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= Metric = 2.0 m > 10 cm No
Certified – MID: T1108 (1.2 m)	Measurement unit Scan head mount height Legal for Trade application	= Metric = 1.2 m Yes (MID)
Certified – MID: T1108 (1.5 m)	Measurement unit Scan head mount height Legal for Trade application	= Metric = 1.5 m Yes (MID)

Profile Name	Use If	
Certified – MID: T1108 (2.0 m)	Measurement unit Scan head mount height Legal for Trade application	= Metric = 2.0 m Yes (MID)
Certified – OIML: R129/2000-NL1-A-20.05 (1.2 m)	Measurement unit Scan head mount height Legal for Trade application	= Metric = 1.2 m Yes (MID)
Certified – OIML: R129/2000-NL1-A-20.05 (1.5 m)	Measurement unit Scan head mount height Legal for Trade application	= Metric = 1.5 m Yes (OIML)
Certified – OIML: R129/2000-NL1-A-20.05 (2.0 m)	Measurement unit Scan head mount height Legal for Trade application	= Metric = 2.0 m Yes (OIML)
US (48")	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= US = 48" > 1.2" No
US (48" with glass platter)	Measurement unit Scan head mount height Scale with glass platter Legal for Trade application	= US = 48" Yes No
US (48" with rgb camera)	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= US = 48" < 1.2" No
US (60")	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= US = 60" > 1.2" No
US (60" with glass platter)	Measurement unit Scan head mount height Scale with glass platter Legal for Trade application	= US = 60" Yes No
US (60" with rgb camera)	Measurement unit Scan head mount height Minimum object height Legal for Trade application	= US = 60" < 1.2" No

Table 2-1. Measurement Parameters

- Selecting any of the “Metric” profiles will prompt for selection of measurement unit: m, mm or cm.

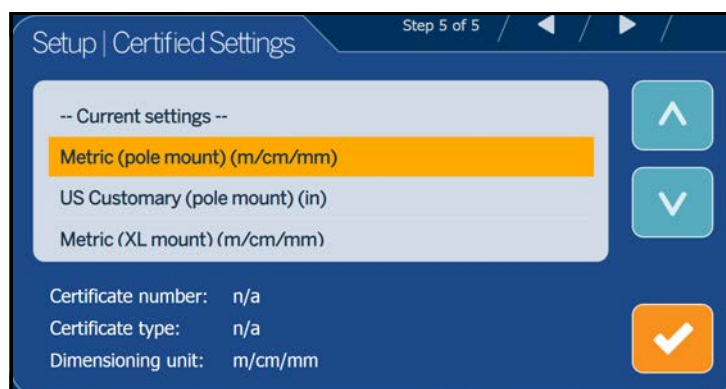


Figure 2-13. Certification Settings – Metric

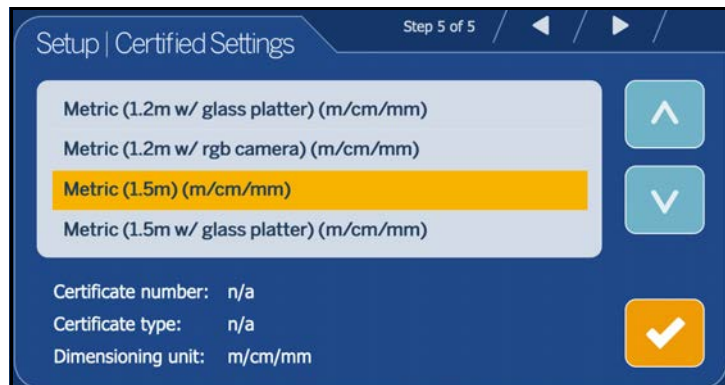


Figure 2-14. Certification Settings – mm

2. Upon completion of the setup wizard, the system restarts. Clear the platform of obstructions to continue.

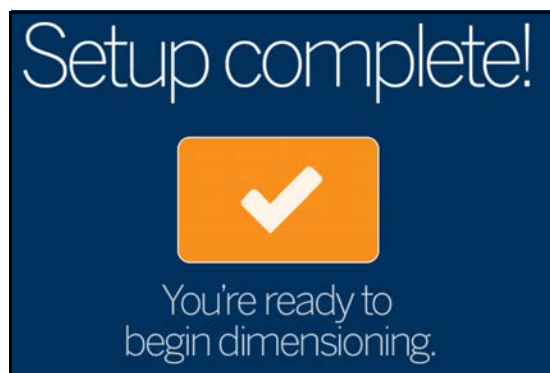


Figure 2-15. Setup Complete

2.2 Next Steps

The setup wizard is now complete. Additional setup requires connection of the iDimension Plus to a PC from a network connection to access QubeVu Manager.

1. Connect iDimension to network ([Section 6.0 on page 27](#)).
2. Configure general settings ([Section 7.2 on page 31](#)).
3. Configure scale settings for connecting to iDimension Plus ([Section 7.2.2 on page 33](#)).
4. Configure network ([Section 7.3 on page 34](#)).

3.0 Touchscreen Display

This section provides an overview of iDimension Plus USB touchscreen display indicators and controls instructions.

The USB touchscreen display combines the weight and dimensions from the iDimension Plus and the optional scale to be visualized.

The touchscreen display provides the dimensions, a live displayed scale weight and operator access to system level controls.

3.1 Touch Screen Display Operation

A live image provides the user feedback on the placement of the item and conditions that may cause the system to be unable to dimension, for example out of bounds. The blue line indicates the scan zone defined during initial setup.

The **Power** button for the USB display is located on the back of the unit. The USB operator display can be configured in QubeVu Manager, see the iDimension Plus QubeVu Managers Guide (PN 195441).

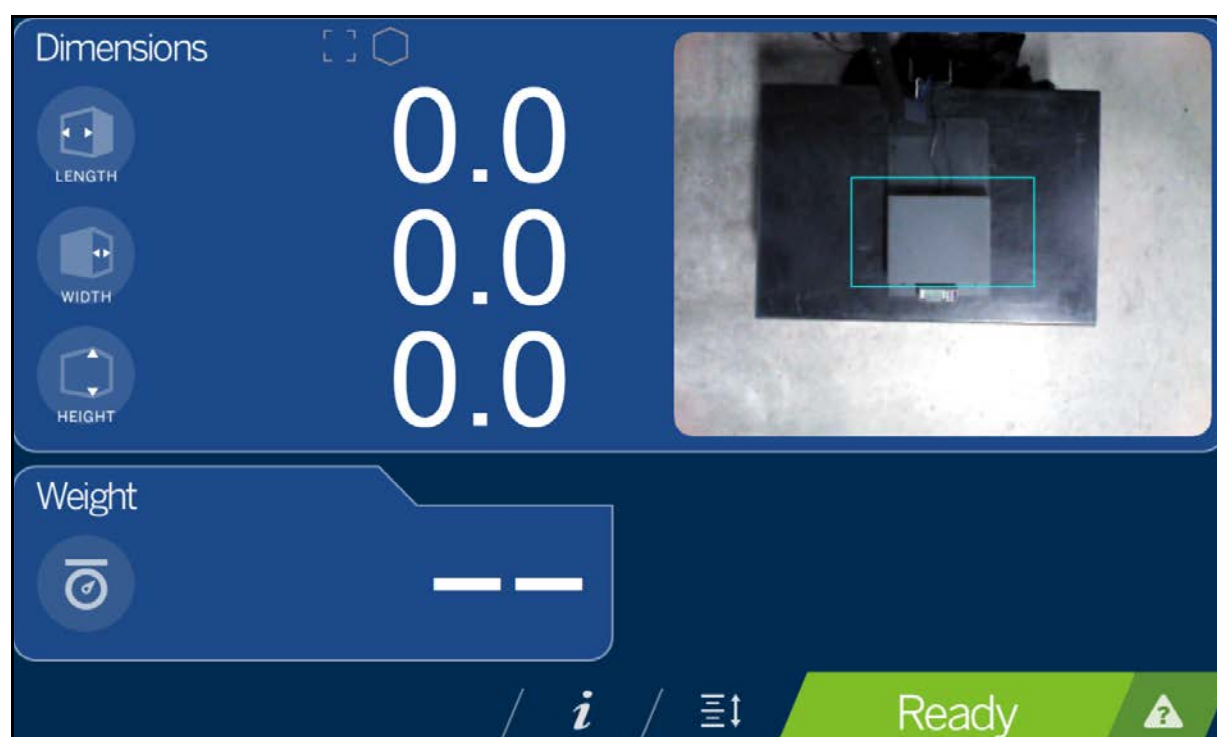



Figure 3-1. Touchscreen Display

Indicators provide out of bounds and shape information for dimensioning. Function keys allow the iDimension Plus to be managed via the touchscreen display.

3.1.1 Live Image

The weigh area provides a real-time view of the scanning area from the scanning head onto the USB display. The blue box within Figure 3-1 is the **Scan Zone** which indicates the area the iDimension Plus will dimension.



3.1.2 Out of Bounds Indication

The **Out of Bounds** icon  indicates the object is not outside of the **Scan Zone**. If the object is outside of the **Scan Zone**, an exclamation point will appear with arrows indicating the direction the object is not within the **Scan Zone**.

If all four of the arrows within the **Out of Bounds** icon are lit , the object being dimensioned is not within the viewing area or the item is too large. The arrows within the **Out of Bounds** icon display the direction which the item is outside of the **Scan Zone**.





3.1.3 Shape Indication

The **Shape Indication** icon indicates the type of shape of the object being dimensioned.

- The **Regular Shape** icon  indicates if the item is dimensioned as a regular shape and the dimensions are displayed in 0.2" or 0.5 cm increments.
- The **Irregular Shape** icon  indicates if the item is dimensioned as an irregular shape and the dimensions are displayed in 0.5" or 0.5 cm increments.

3.1.4 Status Indication

Status indicates the current status of the iDimension Plus unit.

- The **Ready** status  indicates the device is ready to perform a dimensioning transaction
- The **Remove** status  indicates a successful dimensioning transaction is complete
- The **Stopped** status  displays during restart or if the device requires a restart from the **Configuration** menu
- The **Wait** status  displays briefly while dimensioning or if user intervention is required; Select the **Help** function key to see real time feedback of the system if the device displays the started, stopped or wait condition

3.1.5 Help Key

The **Help** function key  displays the **Issue Review** menu.

The **Help** function key provides real time feedback to the operator of the unit. Provides step by step instructions on how to clear conditions such as started, stopped, wait or remove condition with no object in the scan area.

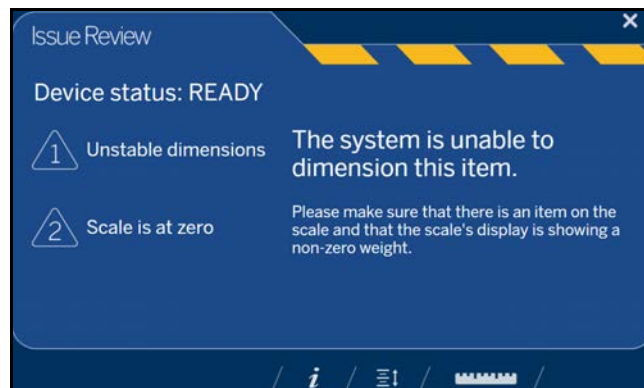

 


Figure 3-2. Issue Review

Select the ruler icon  at the bottom of the touchscreen display to return to the main screen.

3.1.6 Zero Height Key

The **Zero Height** function key  allows the iDimension Plus to calculate the distance between the scan head and the base. Zeroing the height after initial setup is only necessary if the distance between the scan head and the measuring platform changes.


Example: When a scale is added or removed.


To perform the **Zero Height** function, refer to the following procedure:

1. Select the base type of the iDimension Plus.



Figure 3-3. Zero Height Base Selection Display

- If the base is a smooth top scale or no scale, only using the iDimension Plus base, select the scale type and proceed to [Step 3 on page 14](#)
- If the base has an uneven surface (roller balls or conveyor), not using the iDimension Plus base, select the  then continue to [Step 2](#)

2. Place the calibration object on top of the scale then select .

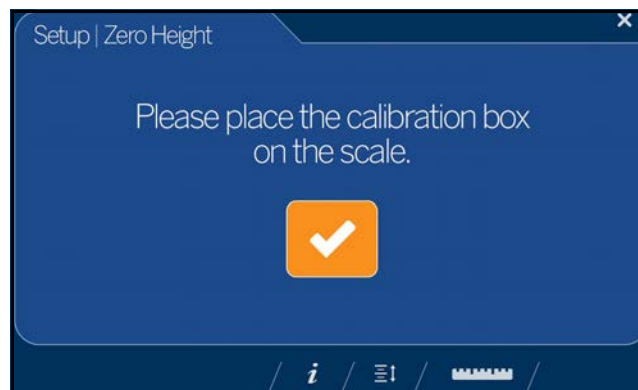



Figure 3-4. Place Calibration Box Display

3. Ensure the platform is clear of other objects then select .

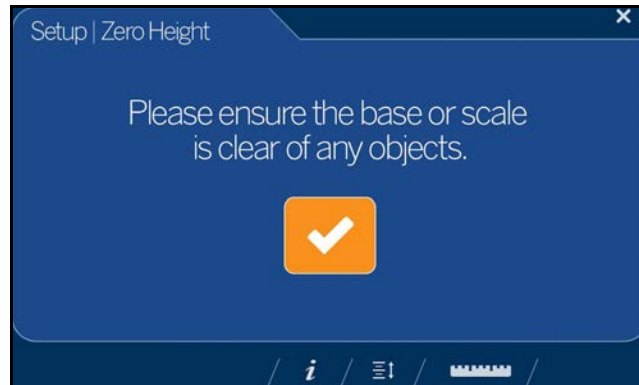


Figure 3-5. Ensure Base is Clear Display




Note

It is important to keep the scale or iDimension Plus base clear and unobstructed during the zero height calibration to set the zero height accurately.

4. Stand clear of the unit before the countdown completes.



Figure 3-6. Stand Clear Display


5. Upon successful zero height calibration then select . The display returns to the **Touchscreen Display** (Figure 3-1 on page 11).
6. Remove the calibration object.



Note

If the zero height fails, ensure the dimensioning area is clear, the scale is level and repeat the zero height function. If unable to perform a successful zero height, calibration may be required (Section 2.0 on page 4).

Configuration Menu Key

The **Configuration Menu** function key  displays the **Configuration Menu**. The **Configuration Menu** provides more configuration options when accessed through touchscreen display than when accessed through a PC.

The options accommodate stand-alone deployments. All options are available from the Admin Tools menu, see the iDimension Plus Managers Guide (PN 195441) for additional **Admin Tools** information.



Figure 3-7. Configuration Menu

Inspection Menu Key


The **Inspection Menu** function key  provides access to **Weight and Measures Inspector** menu.



Figure 3-8. Inspection Menu

4.0 Configuration Menu

This section provides an overview of iDimension Plus configuration menu instructions.

4.1 Access Configuration Menu

To access the **Configuration Menu**, see the following procedure:

1. Select the **Device Information** function key  located at the bottom of the screen (Figure 3-1 on page 11).
2. The **Device Info** menu displays. For **Device Info** information (Section 4.2 on page 21).

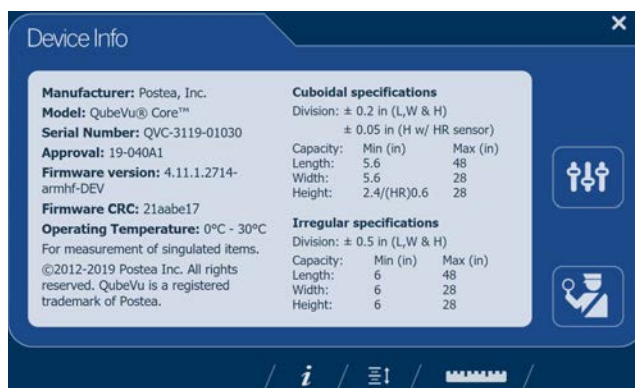


Figure 4-1. Device Information


3. Select the **Configuration** function key  from the **Device Info** menu.
4. The **Configuration Menu** displays. For additional **Configuration Menu** information (Section 4.2.1 on page 21).



Figure 4-2. Configuration Menu

Item	Description	Reference
Setup Wizard	Steps through initial configuration to allow unit operation	Section 4.1.1 on page 17
View EULA	Displays the Software End User License Agreement information	Section 4.1.2 on page 17
Time Zone	Displays the current time zone and allows for time zone configuration	Section 4.1.3 on page 18
Date & Time	Allows the adjustment of date and time	Section 2.1.2 on page 5
Data Extract	View the configuration settings and the current and previous status; Must be configuration in administration mode	Section 4.1.3 on page 18
Scan Zone	Allows for configuration of the Zone of Interest	Section 2.1.3 on page 6
Restart	Select to restart the iDimension Plus unit	Section 4.1.4 on page 19
Enable Flats	Select to configure flat detection settings	Section 4.1.5 on page 19
Upgrade Firmware	Allows for a connected USB drive to update the current device firmware	Section 4.1.6 on page 20
IP Address	Select to view the current IP address of the iDimension Plus unit	Section 4.1.7 on page 21

Table 4-1. Configuration Menu Keys

4.1.1 Setup Wizard

The **Setup Wizard** displays during initial assembly and power-up. If **Setup Wizard** does not display, see [Section 2.1 on page 4](#). Select the **Setup Wizard** to automatically step through the following information.



Figure 4-3. Begin Setup Wizard

4.1.2 View EULA

The **View EULA** button displays the **Software End User License Agreement**.






Figure 4-4. End User License Agreement

4.1.3 Data Extract



If **Long Terms Store** and **Daily Extract** are enabled by the system administrator, the operator can view the configuration settings and current/historical status. All settings are configured in the administrator mode of QubeVu Manager.



Figure 4-5. Extract Data

1. Select  to refresh.
2. Select  to perform a manual export.
3. Select the ruler icon  to return to normal operating mode.

4.1.4 Restart

Select **Restart** for confirmation before restarting the device. Select  to confirm or  to cancel the process.

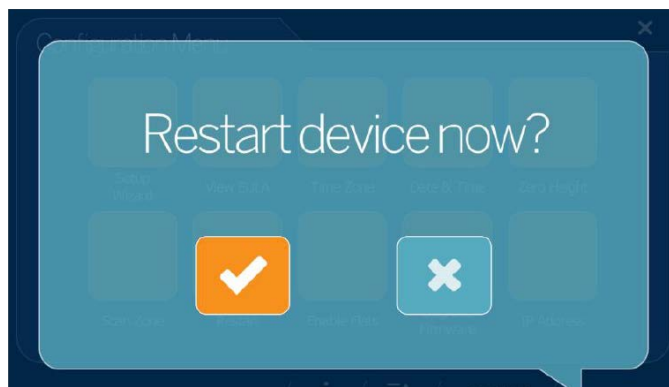



Figure 4-6. Restart

4.1.5 Enable Flats

Flats are objects which are less than the minimum height setting of 3 cm or 1.2". This setting is disabled by default.



Figure 4-7. Flats Detection

1. Select **Enable Flats** to enter **Setup**.
2. Select  to enable flats detection.
3. Flats detection requires either a scale be connected to iDimension Plus or the white dot on the base is visible.



Note If flats detection is enabled, selecting  turns it off.

4.1.6 Upgrade Firmware

Updated firmware may be available at www.ricelake.com. When upgrading the unit, the firmware release must be downloaded to a USB drive.

1. Select **Upgrade Firmware**.
2. Attach the USB drive to the iDimension Plus USB port. Select  to continue.
3. Firmware upgrade files contained on the USB drive are displayed.
4. Select the firmware upgrade required. Select  to continue.

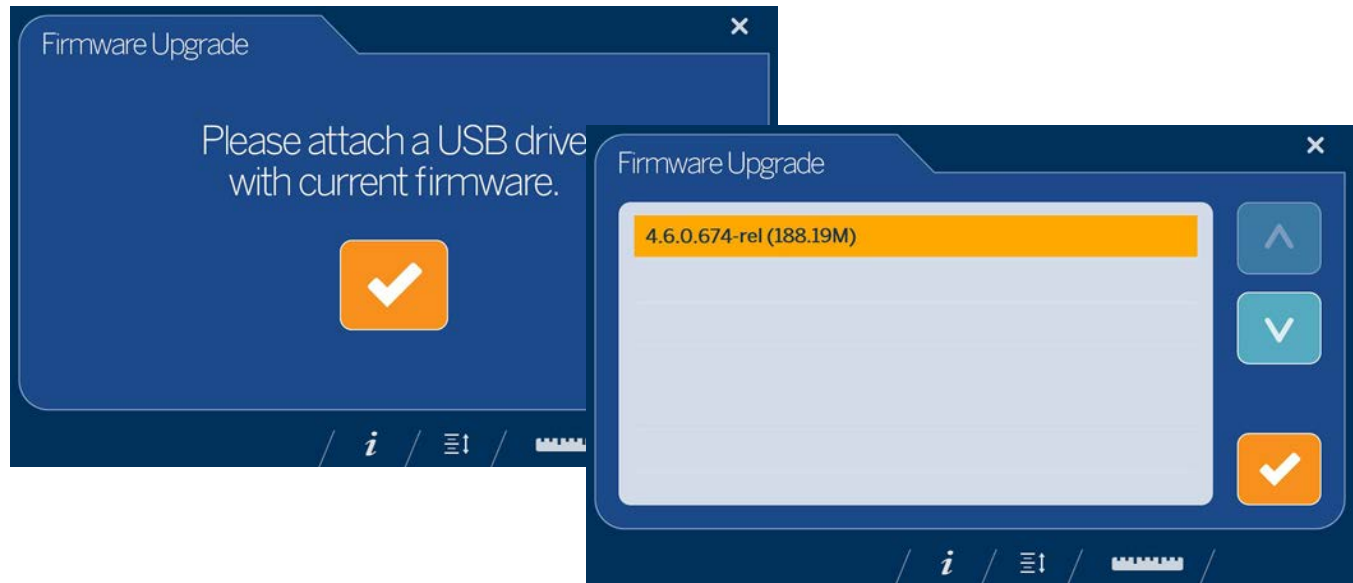


Figure 4-8. Connect USB Drive to Upgrade Firmware



Note

The firmware update is copied from the USB drive to the iDimension Plus. The file checksum is used to validate the file.

Uploading firmware. Please do not interrupt QubeVu during the upload process.

Uploading Firmware

Calculating checksum
Loading


Calculating Checksum

Uploaded file checksum:
d74acd020a469cacaf96715568b8bfb965636f17
Proceed with firmware update?

Uploaded File Checksum

Figure 4-9. Firmware Uploading Messages

5. Select  at the message **Uploaded file checksum** to proceed with upgrade. The update process takes a few minutes. Do not interrupt the process. The iDimension Plus reboots upon completion.



Note

Select  to cancel the process.

4.1.7 IP Address

The IP address displays the current IP address defined by the system administrator or network. Use the displayed IP address to configure the network port to access the Administrative QubeVu Manager software for full system setup and configuration.



Figure 4-10. IP Address

4.2 Device Information

Provides access to a weights and measures inspector, important information about the device.

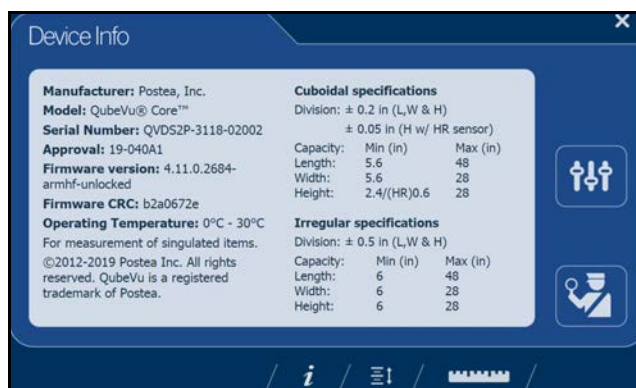



Figure 4-11. QubeVu Inspector Device Information Tab

Select the ruler icon  to return to the normal operating mode.

4.2.1 Device Information Key

The **Device Information** function key  displays the **Device Info Menu**.

Press  to enter into the **Device Info** menu on the USB touchscreen display. The menu provides access to a weights and measures **Inspection** menu and **Configuration** menu for setup of standard user functions ([Section 3.1.5 on page 12](#)).

4.2.2 Weights and Measures

Legal for trade devices using category 3 audit trail, this screen is must be accessed by a local weights and measures inspector.


From the **Device Info** menu, select the **Inspection** button .







Figure 4-12. Inspection Menu

Certification Change Log

The **Certification Change Log** provides a log of configuration and calibration changes for weights and measures inspectors.



Figure 4-13. Certified Change Log

- Select  or  arrows to scroll up through the log.
- Select the ruler icon  to return to normal operating mode.
- Select  to return to previous screen.

Transaction Log

For specific applications and International approvals, requires long term storage audit trail to be configured in the QubeVu Manager **Measurement Settings** tab. If not configured, **No LTS data is available** displays.

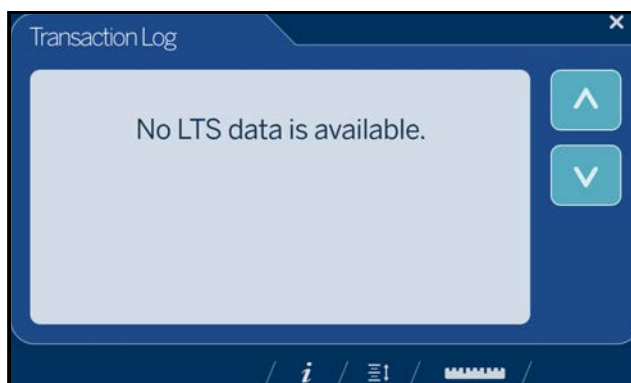


Figure 4-14. Transaction Log

5.0 Use and Operation

For use and operation information, see the following procedure:

5.1 Measurement Capabilities

When reporting dimensions of an item, the device defines length, width and height as follows:

- Length – Longer of the two horizontal measurements
- Width – Shorter of the two horizontal measurements
- Height – Vertical measurement

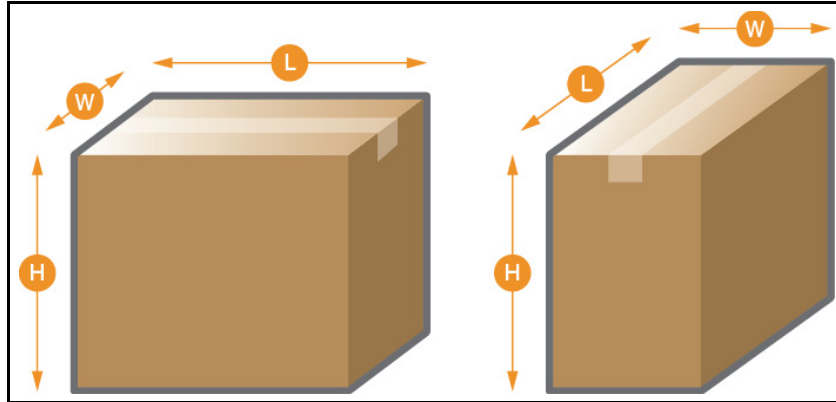


Figure 5-1. Object Measurements

The iDimension Series has been tested and approved with an OIML & MID certified accuracy of ± 5 mm on regular shaped items. See [Section 9.0 on page 43](#) for additional specification information.



Note

Minimum and maximum certified capacities do not reflect certified performance specifications. Contact Rice Lake Weighing Systems for details.

When a scale is used on top of the base plate, it reduces the maximum object size available since it reduces the distances between the scanning head and base plate.

5.1.1 Flats

Dimensioning objects smaller than 1.2" (3 cm) in height requires the following:

- Selection of the correct configuration profile ([Section 2.1.5 on page 8](#))
- A connected scale or use of the **Disk Finder** feature.

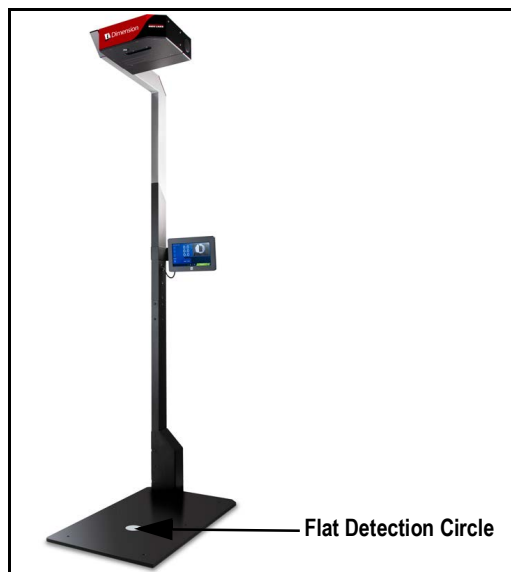


Figure 5-2. Flat Detection Circle

5.1.2 Object Types

The iDimension Plus is factory configured to dimension both cube (rectangular) and irregular shaped objects. Irregular shaped objects are dimensioned as rectangles around the shape.

See [Table 5-1](#) for an example of how and what types of shapes the iDimension Plus will measure.

 
 

 


 




 



Shape	Description	Shape	Description
	Standard cube		Cube with a sloped side
	Cylinder		Cube with one irregular side
	Donut		Overstuffed cube
	Sphere		Crumpled cube
	Polybag		Cube with handles
	Tube		Cube on a cube
	Triangular tube		Cube next to a cube
	Cube with an uneven top		

Table 5-1. Irregular Shapes

Item Placement

For best results, place the item centrally below the scanning head. If the **Zone of Interest** or **Work Area** are configured too small, errors may occur.

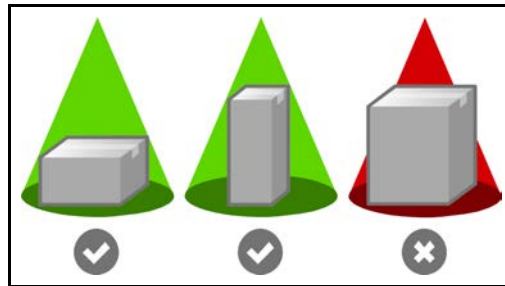


Figure 5-3. Item Placement

The maximum size of an item to be dimensioned varies due to the camera's field of view.

5.2 Performing A Measurement

This section provides an overview of how to perform a measurement.

5.2.1 Automatic Package Detection

1. To dimension, the iDimension Plus must be in a **Ready** status and the scale, if used, is at zero weight.



Figure 5-4. Ready Status

2. Place object within the **Zone of Interest**. Once the scale has settled and there is no motion within the **Work Area**, the iDimension Plus will provide the dimensions, weights and image of the package with a blue bounding box representing the measurements displayed.



Note To enable Manual Trigger Mode, attach an optional bar code scanner or use a third-party software to trigger a dimension.



Figure 5-5. Zone of Interest

3. Remove the object. The system returns to the **Ready** status.



Figure 5-6. Ready Status

4. If the system does not return to the ready state, select the **Help** function key on the USB display and follow the instructions to return the iDimension Plus to the **Ready** status.

Item Out of Bounds

If trying to dimension an object that is too large for the field of view of the system, the system will provide an indication of out of bounds, use the out of bounds indicator to determine if reposition is required.



Figure 5-7. Out of Bounds Flat Detection Circle



Note See [Section 4.1.3 on page 18](#) to *adjust the scan zone*.

6.0 Network Connection

iDimension Plus is installed as a network device and supports both static and dynamic IP configuration. DHCP is enabled as default, however, it also has a fixed, failsafe IP address of 169.254.1.1 which can be used for initial setup and configuration.

Configuring the iDimension Plus uses the embedded firmware, QubeVu Manager, which is accessed via an IP address over a wired Ethernet connection through a web browser.



Figure 6-1. QubeVu Manager



6.1 Connection

If using DHCP, connect the iDim to the network and follow the instructions in [Section 6.2](#) to determine the IP address. Alternatively, contact your local IT Department.

If using a static IP address, connect the iDim directly to a laptop or PC and follow the instructions in [Section 6.3 on page 28](#).

6.2 DHCP Connection

To connect via DHCP, see the following information:

1. Connect the Ethernet cable to the back of the iDimension Plus and to the network.
2. Power on the iDimension Plus.
3. The network assigns an IP address.
4. To identify the IP address assigned from the touchscreen display, select the **Device Information** function key .
1. From the **Information** menu, select the **Configuration Menu** function key  to access the configuration menu.
2. Select the **IP Address** button, document the IP address.
3. Open a web browser, Google Chrome is the recommended web browser, type in the IP address into the web browser, the QubeVu Manager menu displays.
4. See [Section 7.3 on page 34](#) for advanced network adapter settings.

6.3 Static IP Connection

To connect via the static, failsafe IP, see the following information:


1. Connect a laptop/PC directly to QubeVu using a standard Ethernet cable. It is important this is a direct connection with no hubs/switches in between.
2. Configure the Ethernet port on the laptop/PC with the following IP settings:
3. IP Address: 169.254.1.10
4. Subnet mask: 255.255.0.0
5. Confirm connectivity by pinging 169.254.1.1
6. If ping is successful, QubeVu Manager should be accessible at <http://169.254.1.1>

The 169.254.1.1 failsafe address is intended for use during initial setup to access QubeVu Manager and facilitate configuring a static IP address. See [Section 7.3 on page 34](#) for advanced network adapter settings.

6.4 Admin Tools Menu

Admin Tools are used for configuring, calibrating, defining, upgrading, backing up and running diagnostics on the system.

To enter the **Admin Tools** menu use the following steps.

1. From the QubeVu homepage, select  **Admin Tools** to log in.
2. The default user name is **admin** and the default password is **password**.
3. Select desired tool within the **Admin Tools** menu.

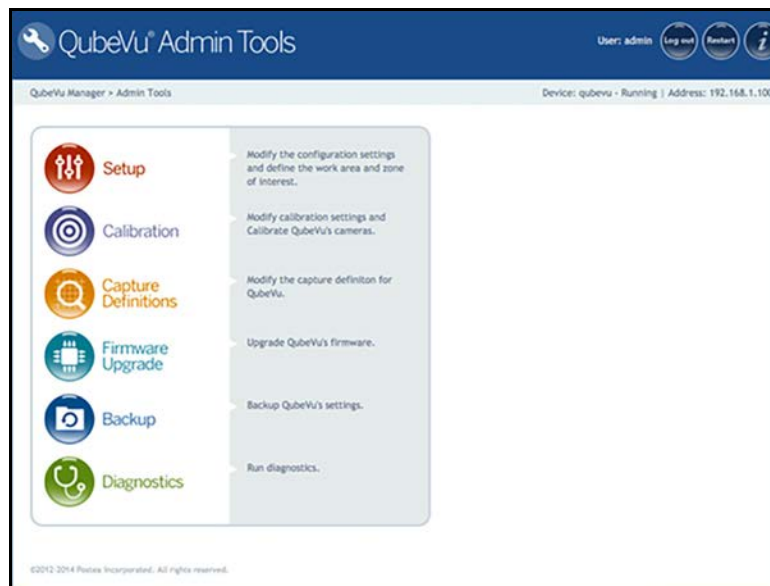


Figure 6-2. Admin Tools Menu

Parameter	Description
Setup	Configuration settings, define Work Area and Zone of Interest (Section 4.0 on page 16)
Calibration	Calibration settings, calibrate cameras, time and date, data extraction and long term storage (Section 7.0 on page 30)
Capture Definitions	Capture definitions for QubeVu
Firmware Upgrade	Update firmware (Section 8.0 on page 36)
Backup	Backup and restore settings; See the iDimension Plus QubeVu Managers Guide (PN 195441) for additional backup details
Diagnostics	Diagnostics settings (Section 8.1 on page 36)

Table 6-1. Admin Tools

6.4.1 Edit/Cancel/Save Keys

While in the **Admin Tools** menus, on the right side of the screen the **Edit**, **Cancel** and **Save** keys are active.



Figure 6-3. Edit/Cancel/Save Keys

Edit

Display while in the general setting mode and calibration menu. Prior to making changes to these settings, select **Edit**. Change the settings then select **Save** to continue.

Cancel

Cancels all edits made to all tabs, unless saved.

Save

The **Save** key saves all changes made during the edit process within the page and a sub menu tab. Upon save, the unit may restart and return to the home screen.

7.0 Setup

This section provides an overview of iDimension Plus setup instructions, using QubeVu Manager.

For complete QubeVu Manager setup instructions, see the iDimension Plus QubeVu Managers Guide (PN 195441).

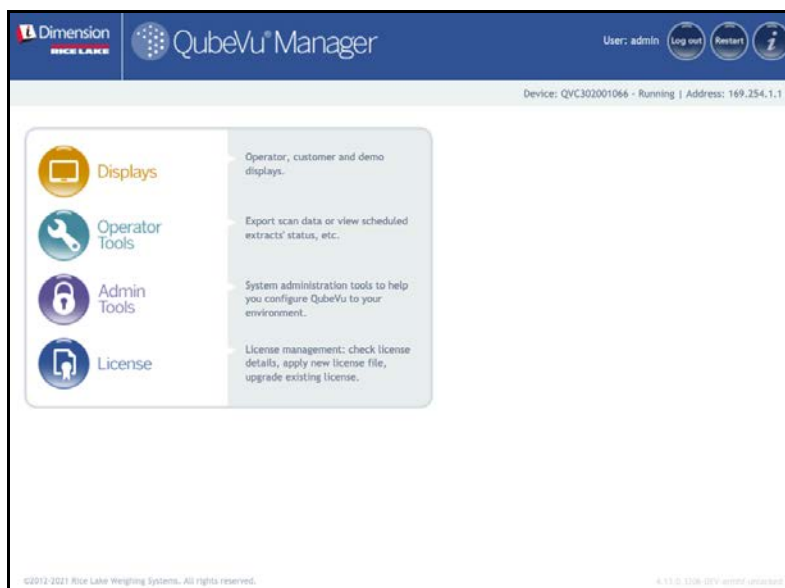



Figure 7-1. QubeVu Home

7.1 Setup Menu

Select  **Setup** to enter the setup menu.

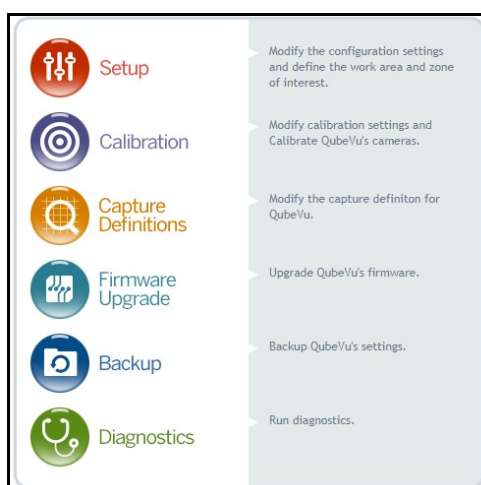





Figure 7-2. QubeVu Setup

7.2 General Settings

1. From the QubeVu Manager menu, select  Admin Tools.
2. The QubeVu Manager login screen displays. The username is **admin**. The password is **password**.
3. Select  Setup.
4. Select  General Settings.

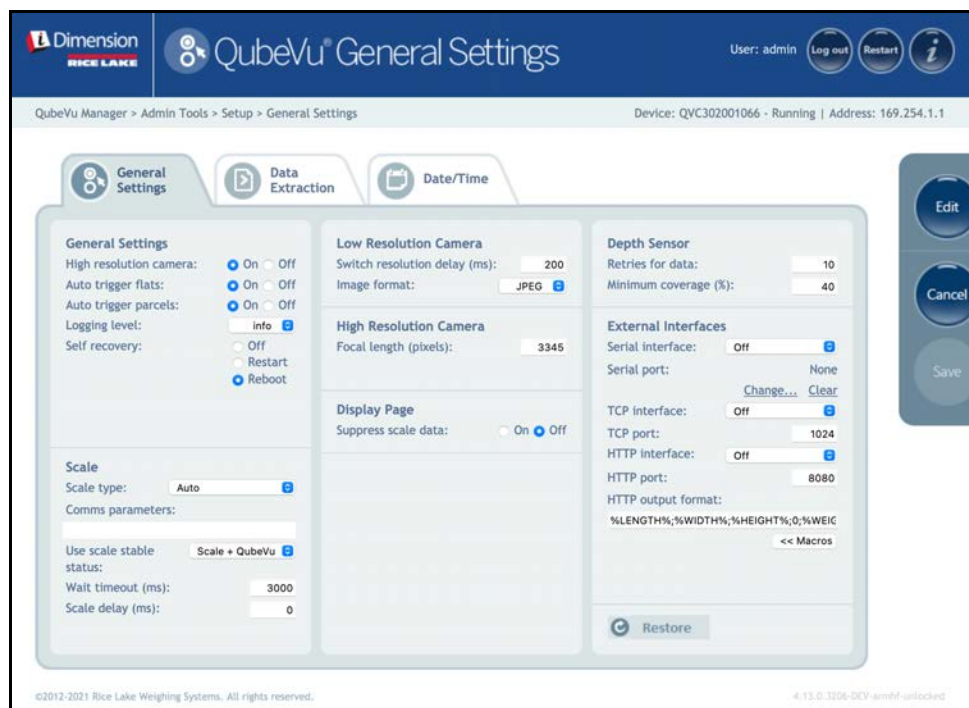


Figure 7-3. Setup – General Settings

7.2.1 General Settings Parameters

Below are the default factory settings.

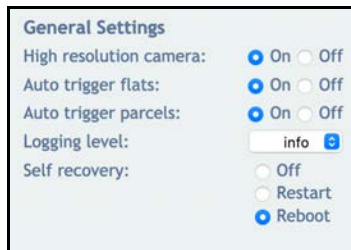


Figure 7-4. General Settings

Parameter	Description
High Resolution Camera	Enables or disables the high resolution camera; NOTE: High resolution cameras are not present in all models. High resolution image capture is controlled by the Capture Definitions
Auto Trigger Flats	Determines if the capture (dimensions, weight, image) is automatically triggered for items classified as flats; On = capture initiated when a flat item is placed in the Work Area , item is stable and a stable weight has been received from a connected scale, default
Auto Trigger Parcels	The default setting is On ; A parcel is defined as a package that is determined automatically at 85% or higher in a cuboid score
Logging Level	The default setting is Info ; Changing to error or debug will increase the amount engineering and performance information stored in the diagnostics and log files shown in "ipaddress/log" command
Self Recovery	The default setting is Reboot ; Off – System will not perform a self recovery; Restart – If the system has determined a critical error state, the unit will perform a restart of the software and returns the system to normal mode; If an object is under the device during a reboot, Wait will be displayed on the USB display; Clear the platform to return to ready state; Reboot – If the system has determined a critical error state, the unit will perform a reboot, an automatic power cycle that clears the error and returns the system to normal mode; If an object is under the device during a reboot, Wait will be displayed on the USB display; Clear the platform to return to ready state; If the scale is receiving power from the USB port, check to make sure the scale is on and working properly

Table 7-1. General Settings Parameters

7.2.2 Scale

The iDimension Plus is designed to directly interface to common shipping scales. Each scale has unique interface protocols that are designed to work with common shipping systems.

Refer to the manufacturers manual to determine the available “protocols” to choose from.

The iDimension Plus provides a USB port for connecting the scale. Some scale manufacturers may vary on the compatibility and capabilities of protocols for a scales with RS-232 or USB connections.



Note

A scale with USB HID is a standard Windows and USB.org protocol that works with scales when displaying weight lb or kg. If a Postal Scale displaying weight in lb/oz the USB HID protocol does not function.

If the scale is equipped with only an RS-232 port, a compatible FTDI RS-232/USB Converter (PN 178501) is required.

Figure 7-5. Scale Settings

Parameter	Description
Scale Type	Selectable from a drop-down list: Auto – Upon Start-up or reset, the iDimension Plus automatically attempts to identify a scales factory default settings; It is recommended to use one of the scale manufacturers; USB HID scales are not supported None – No scale is connected External – Requires advanced integration using iDimension Plus API; With no scale connected USBHID* – A compatible scale using scale using USB HID protocol; See Comms parameter Mettler Toledo – A scale configured for the Mettler Toledo Standard protocol MTSICS –A scale configured for using the (Mettler Toledo Standard Interface Command Set) NCI – A scale using the Avery Weigh-Tronix/NCI protocol; For Rice Lake BenchPro Postal Scales, use this setting for scales in lb/oz mode Pennsylvania7300 – The Pennsylvania 7300 scale is used
Communication Parameters USB RS-232	Enter the RS-232 parameter settings of the scale selected; See the scale manufacturers operator’s manual for instructions: Baud Rate – 1200, 2400, 4800, 9600, 14400, 19200, 38400, 57600 and 115200 Parity – None, Odd, Even Bits – 5,6,7,8,9 Stopbits – 1, 1.5, 2 <i>Example: 9600,N,8,1</i>
Communication Parameters USB HID	The following is a list of Compatible USB HID scales including the Vendor ID and product ID; The following example is for a Rice Lake BenchPro Scale; 1C19 is the vendor ID and 0002 is the product id; Use a comma to separate the values (Table 7-3) <i>Example: 1C19,0002</i>

Table 7-2. Scale Parameters

Manufacturer	Model	Vendor ID	Product ID
Rice Lake Weighing Systems	BenchPro Series	1C19	0002
Fairbanks Scale	Ultegra Series	0b67	0x555e
Mettler Toledo	PS / BC Series	0922	F000
Dymo Costar	M10	0922	8003
Dymo Costar	S50	0922	8007

Table 7-3. Scale Manufacturer Information

Parameter	Description
Use scale stable status	Use Scale Stable Status determines when iDimension locks the displayed weight and dimensions on the touchscreen display (Table 7-4); Dimensions are locked and the remove state is displayed using both the scale stable reading and iDimension filter Scale+QubeVu – This is the default factory setting and is recommended for use; QubeVu – Dimensions are locked and remove is displayed without checking if the scale is stable; Using this feature may provide incorrect weight on the display; Not recommended for use; Scale – Dimensions are locked and remove is displayed when the scale has returned a stable reading to the iDimension; Not recommended for use, this may increase the remove state to more than 3 seconds
Wait Timeout (ms)	The time in milliseconds the dimensions wait for the scale to return a stable weight; System timeouts and does not return to the remove state; Increase this settings if the scale is in an unstable environment
Scale Delay (ms)	The time in milliseconds in which the iDimension requests a weight from the scale; Increase this setting to 500 ms to allow the weight on the scale to stabilize, if experiencing incorrect weights being displayed on the iDimension vs the scales display

Table 7-4. Use Scale Stable Status Selections



Note If the required scale is not listed, contact Rice Lake Weighing Systems to purchase a BenchPro scale.

7.3 Network

Use the **Network** tool to define network settings.


Press  **Network** while within the **Setup** menu.

Figure 7-6. Network Interface Settings

Enter or modify the network settings for the enterprise network.

Parameter	Description
DHCP	Have the network administrator verify if the iDimension Plus is to be set up on the network using the Dynamic Host Configuration Protocol (DHCP); If DHCP is checked, a unique Host Name for this device must be defined; The name is used to access the device from the Manager Tools in the future; A host name can be up to 15 characters Example: http://<hostname>/
IP Address	If DHCP is checked, do not enter an IP address; If DHCP is not checked, define a unique IP address for each iDimension Plus is installed; Default IP address: 169.254.1.1 Consult with the network administrator if unsure how to assign a new IP address; If using fixed IP addresses, access iDimension Plus by the hostname or the IP address: http://<hostname>/ http://<ip address>/
Subnet Mask	Default subnet mask: 255.255.255.0 ; Consult the network administrator for the correct setting
Gateway	Default gateway: 0.0.0.0 ; Consult the network administrator for the correct setting
Hardware Address	Do not modify; Each iDimension Plus has been assigned a unique hardware address
Host Name	The default host name is the alphanumeric portion of the device serial number; A unique host name may be defined for each device; Up to 15 characters are allowed for the Host Name

Table 7-5. Network Interface Parameters

7.3.1 Network Security

Network Security settings allow enhanced security by encrypting communications with the iDimension Plus using the Hypertext Transfer Protocol (HTTPS). By default, communication with the iDimension Plus is via HTTP.

- Select the **Network Security** tab to display the current settings.
- Click on **Enable HTTPS** to enable HTTPS.
- Click **Browse** to select your SSL key and cert files, then Upload.
- Select **Upload** to transfer the information from the PC to the iDimension Plus.



Note *SSL certificates are not supplied by Rice Lake Weighing Systems. Contact your IT Department for further information.*

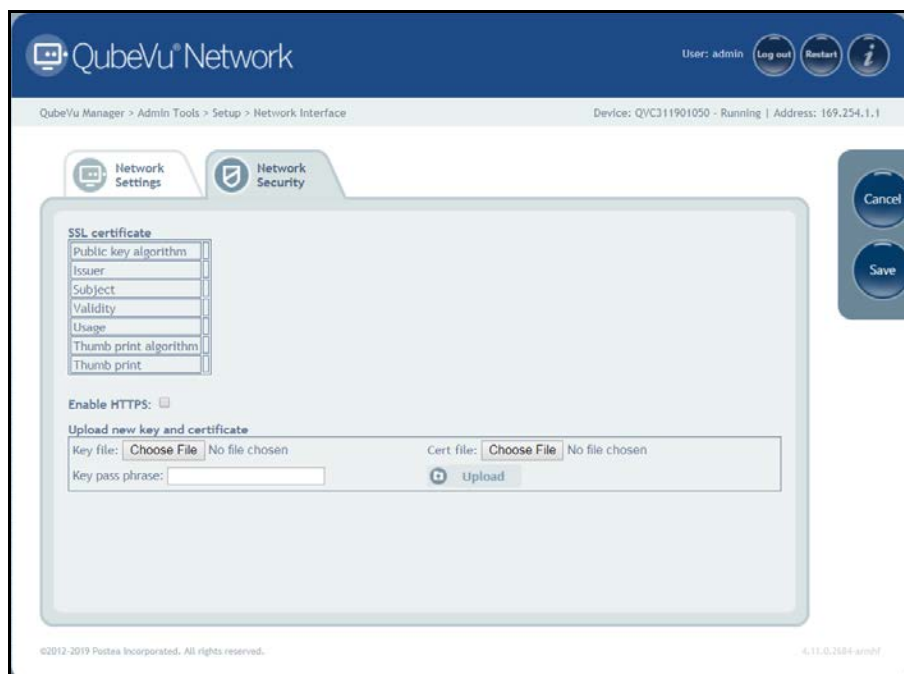


Figure 7-7. Network Security



Note *With HTTPS enabled, both the HTTP and the HTTPS addresses are available.*

8.0 Appendix

This section provides an overview of additional iDimension Plus instructions.

8.1 Diagnostics

This section provides an overview of iDimension Plus diagnostics instructions.

The **Diagnostics** tools can be used to test hardware components and gather diagnostic information.



Note

The Administrator defined a username and password during the initial setup process. The username and password are required to log into and access the iDimension Plus Admin Tools.

8.1.1 Diagnostics Menu

The **Diagnostics** menu provides tools to help troubleshoot the device.

From the **Admin** menu, select  **Diagnostics** to enter the setup menu.

The **Diagnostics** menu has four tools used for testing hardware and for providing information about the system.

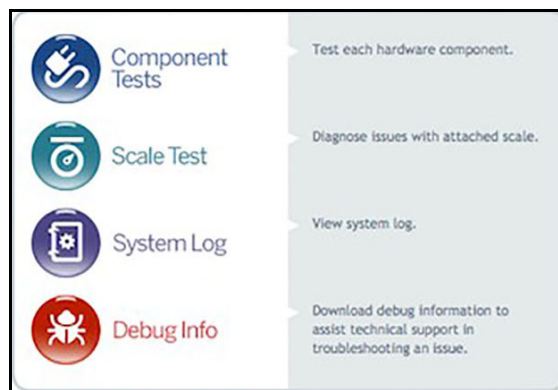



Figure 8-1. Diagnostics Menu

8.1.2 Component Tests

The **Component Tests** menu is used to test hardware components individually or all at once.

- Select **Test All** to test all hardware components; If a scale is connected the camera level test will fail
- Select  to test individual components

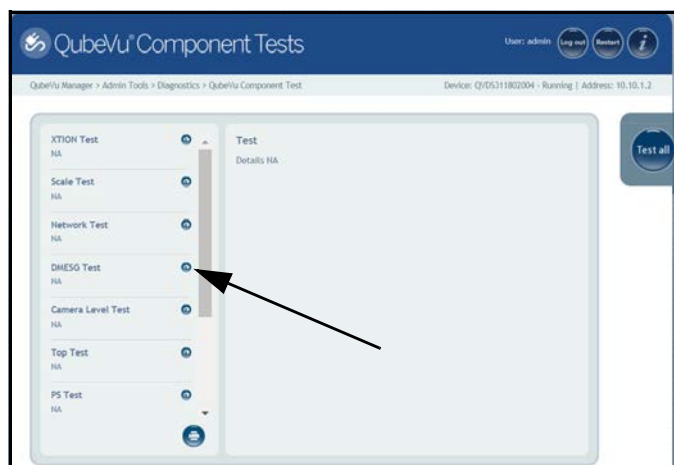


Figure 8-2. Component Tests

The status of each individual component is returned as either **Passed** or **Failed**. Additional details can be viewed by selecting the test name.



Figure 8-3. Component Test Successful


See [Table 8-1](#) for common tests to run for troubleshooting:

Field Test	Description
Depth Sensor	Tests the main sensors to determine operating status
High-res Camera	Tests the high resolution camera to determine operating status
Scale	Tests the scale is communicating using the scale parameters configured in Admin Tools > Setup > General Settings
Network	Tests the network link speed. Failure is indicated when the link speed is < 1000Mb/s
DMESG	Displays information on low-level hardware components
Camera Level	Manufacturing test; Not intended for field use
Top	Displays information on CPU and memory utilization
PS	Displays information on running processes
Serial Number	Checks for a valid serial number and model
Port	Displays information on USB buses
Temperature	Displays the SBC temperature

Table 8-1. Component Test Descriptions

8.1.3 Scale Test

The **Scale Test** tool is used to help determine the communication settings of a serial scale attached to the iDimension Plus.

1. Select the **Serial Port** and **Scale Type** from the drop down lists.
2. Select  to start the test.

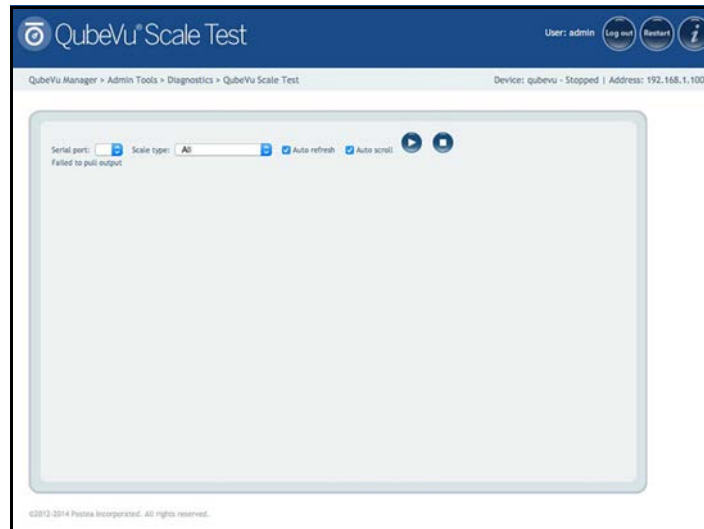


Figure 8-4. Scale Test

3. If a valid scale is detected, the output provides the scales communication parameters.

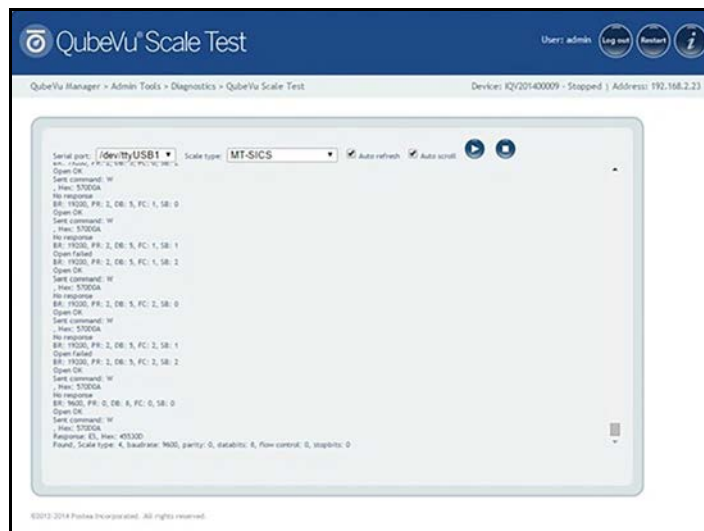


Figure 8-5. Scale Communication Parameters

8.1.4 System Log

The system log storage data is configured in the setup menu. For troubleshooting, the file may be required to be sent to the factory for engineering analysis and troubleshooting. The log view can be customized by type (view all or view info, debug or error messages only) or by order (view the latest first or the earliest first).

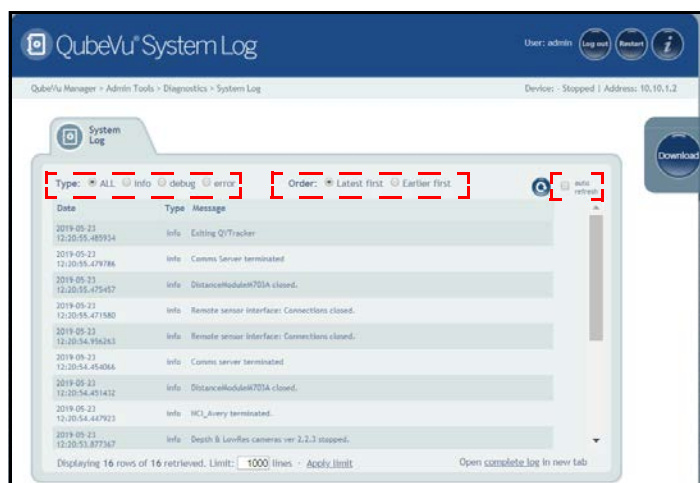


Figure 8-6. System Log

The log can be refreshed by pressing  or automatically refreshes by checking the auto refresh box.

To download the log to a CSV file, press **Download**.

8.1.5 Debug Info

The **Debug Info** is a file that provides engineering and trouble shooting information of the operation of the unit.

This file may be requested for troubleshooting purposes. Select the desired information to be downloaded.

1. Press **Download** to save the file to the computer.

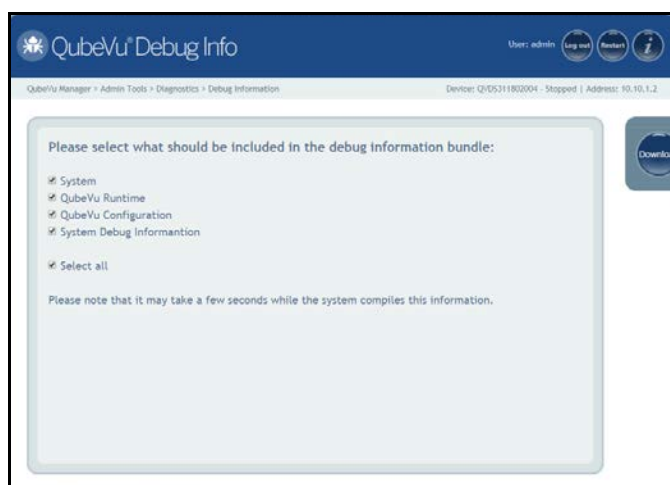


Figure 8-7. Debug Info

8.2 Troubleshooting

This section provides an overview of iDimension Plus troubleshooting instructions.

8.2.1 iDimension Plus Does Not Return to Ready State

1. Select the Help function key on the USB display.

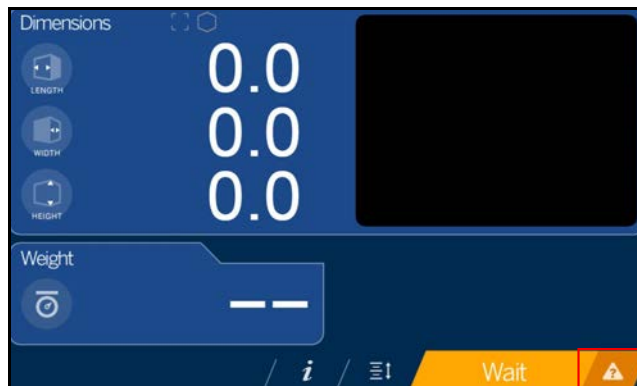


Figure 8-8. Help Button

2. Follow the provided help instructions to return the iDimension Plus to **Ready** state:
 - A. **Device status: STARTED** or **REMOVE** displays; Clear the scale of obstructions
 - B. Zero the scale

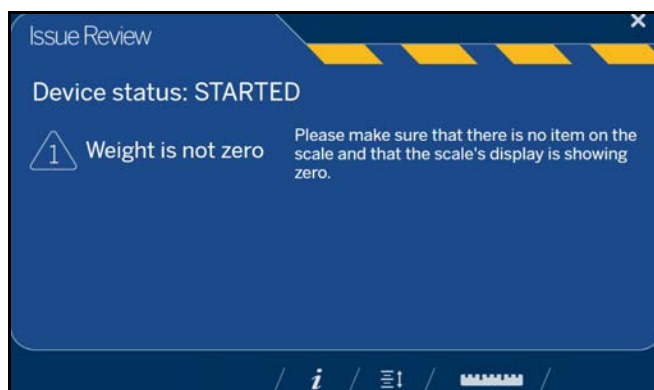


Figure 8-9. Device Status Started

- C. The iDimension Plus is zeroed



Figure 8-10. iDimension Plus Zeroed

8.2.2 iDimension Plus Display is Off or Blank

1. Check power connection on the back of the iDimension Plus and the 120 V outlet
2. Check USB connection on back of USB display
3. Press the **Power** button on the back of the USB display
4. Power cycle the iDimension Plus
5. Check connection on scanning head

8.2.3 iDimension Plus Display is Green

1. Check access to QubeVu Manager:
2. Connect a laptop/PC directly to QubeVu using a standard Ethernet cable. It is important this is a direct connection with no hubs/switches in between.
3. Configure the Ethernet port on the laptop/PC with the following IP settings:
 - IP Address: 169.254.1.10
 - Subnet mask: 255.255.0.0
4. Confirm connectivity by pinging 169.254.1.1
5. If ping is successful, QubeVu Manager should be accessible at <http://169.254.1.1>

8.2.4 iDimension Plus Display is Locked and Will Not Dimension

1. Power cycle the iDimension Plus from an AC Outlet.
2. Restart the iDimension Plus.
3. Select **i** on the touch screen display.



Figure 8-11. USB Display Touch Screen Not Functioning

4. Select **Setting**.

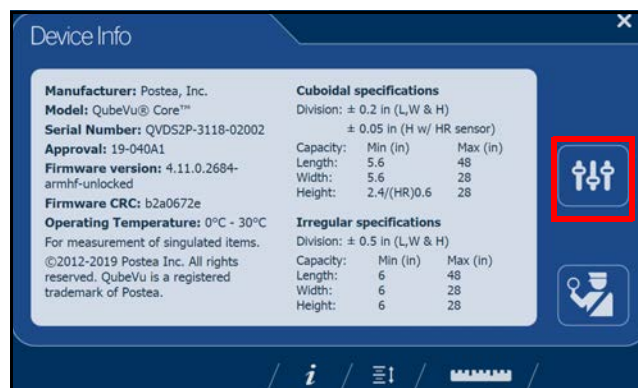


Figure 8-12. QubeVu Inspector Device Information Tab

5. Select **Restart**.

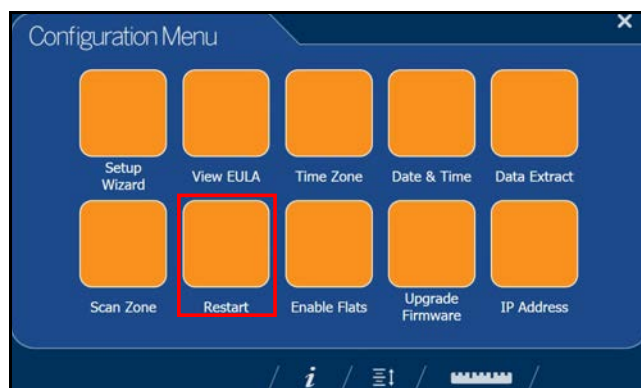


Figure 8-13. USB Display Touch Screen Not Functioning

6. Select  to restart the device.

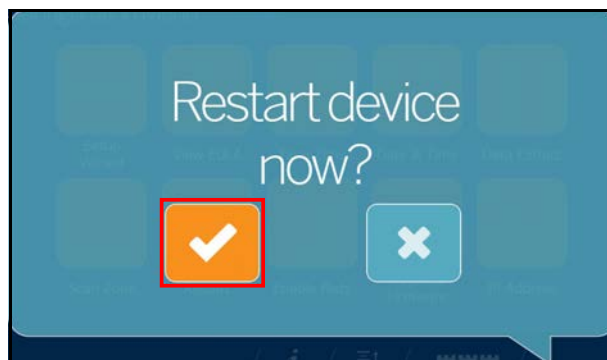


Figure 8-14. Restart Confirmation

7. The USB display will go to a green display and within 2 minutes return to the ready state.

9.0 Specifications

Product Dimensions

Length	25" (63.5 cm)
Width	14.25" (56 cm)
Height	63.8" (162 cm)
Weight	28.5 lb (13 kg)

Power Requirements

Single power source 110–240 V external power supply, US power cord

Object Colors

All opaque packaging

Measurement Time

0.2 seconds, scale setting times vary by manufacturer

Warranty

Two-year limited warranty

Certifications and Approvals



EU
File Number: T11908



OIML
File Number: R129/2000-A-NL1-20.05

Cuboidal Specifications

	Length	Width	Height
Maximum Length	≤ 48" (120 cm)	≤ 28" (80 cm)	≤ 28" (80 cm)
Minimum Dimension	≥ 5.6" (14 cm)	≥ 5.6" (14 cm)	≥ 2.0" (5 cm)
Accuracy	± 0.2" (0.5 cm)	± 0.2" (0.5 cm)	± 0.2" (0.5 cm)

Irregular Specifications

	Length	Width	Height
Maximum Length	≤ 48" (120 cm)	≤ 28" (80 cm)	≤ 28" (80 cm)
Minimum Dimension	≥ 5.6" (3 cm)	≥ 1.2" (3 cm)	≥ 0" (0 cm)
Accuracy	± 0.5" (1 cm)	± 0.5" (1 cm)	± 0.5" (1 cm)



Note

Specifications depend on hardware configuration and certification requirements. Please contact your sales representative for further information.

Operating Temperature

32°F–86°F (0°C–30°C)

Humidity

Non-condensing

Mechanical Environment Class

M1

Electromagnetic Class

E1

I/O Ports

(1) USB type A port (interface to scale)

(1) 10/100/100BASE-T Ethernet port (interface to PC)

Software Integration

API and SDK files available for network device integration



© Rice Lake Weighing Systems Specifications subject to change without notice.
Rice Lake Weighing Systems is an ISO 9001 registered company.

230 W. Coleman St. • Rice Lake, WI 54868 • USA
U.S. 800-472-6703 • Canada/Mexico 800-321-6703 • International 715-234-9171 • Europe +31 (0)26 472 1319